


SERVICE BULLETIN

CAB SERVICE & PARTS CORPORATION

NEW YORK AND CHICAGO

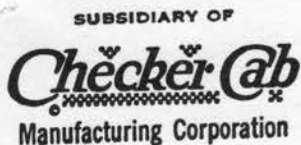

November 12, 1956

SUBJECT: WINDSHIELD WIPERS

DESCRIPTION: MODEL A-8

The following is a recommended service procedure on windshield wiper pivot cable and tensioner assemblies:

1. Loosen adjusting nut on tensioner and allow spring to take up slack in cable.
2. Lock tensioner nut (do not add more tension on cables than spring allows).
3. Tighten nut on pivot head which fastens pivot to windshield bar.
4. Repeat above procedure on opposite cable and tensioner.
- *5. Spray with graphite powder, the wheels and shafts on both pivot cable assembly and tensioner.
6. Reset wiper arms and blades so that wiping action is centered and blades do not contact windshield glass rubber seals.

*A pressurized can of graphite powder is recommended for this lubrication.

By: NEW YORK
SERVICE DEPARTMENT